



A80 - CURRENT AND FORCE BY PWM

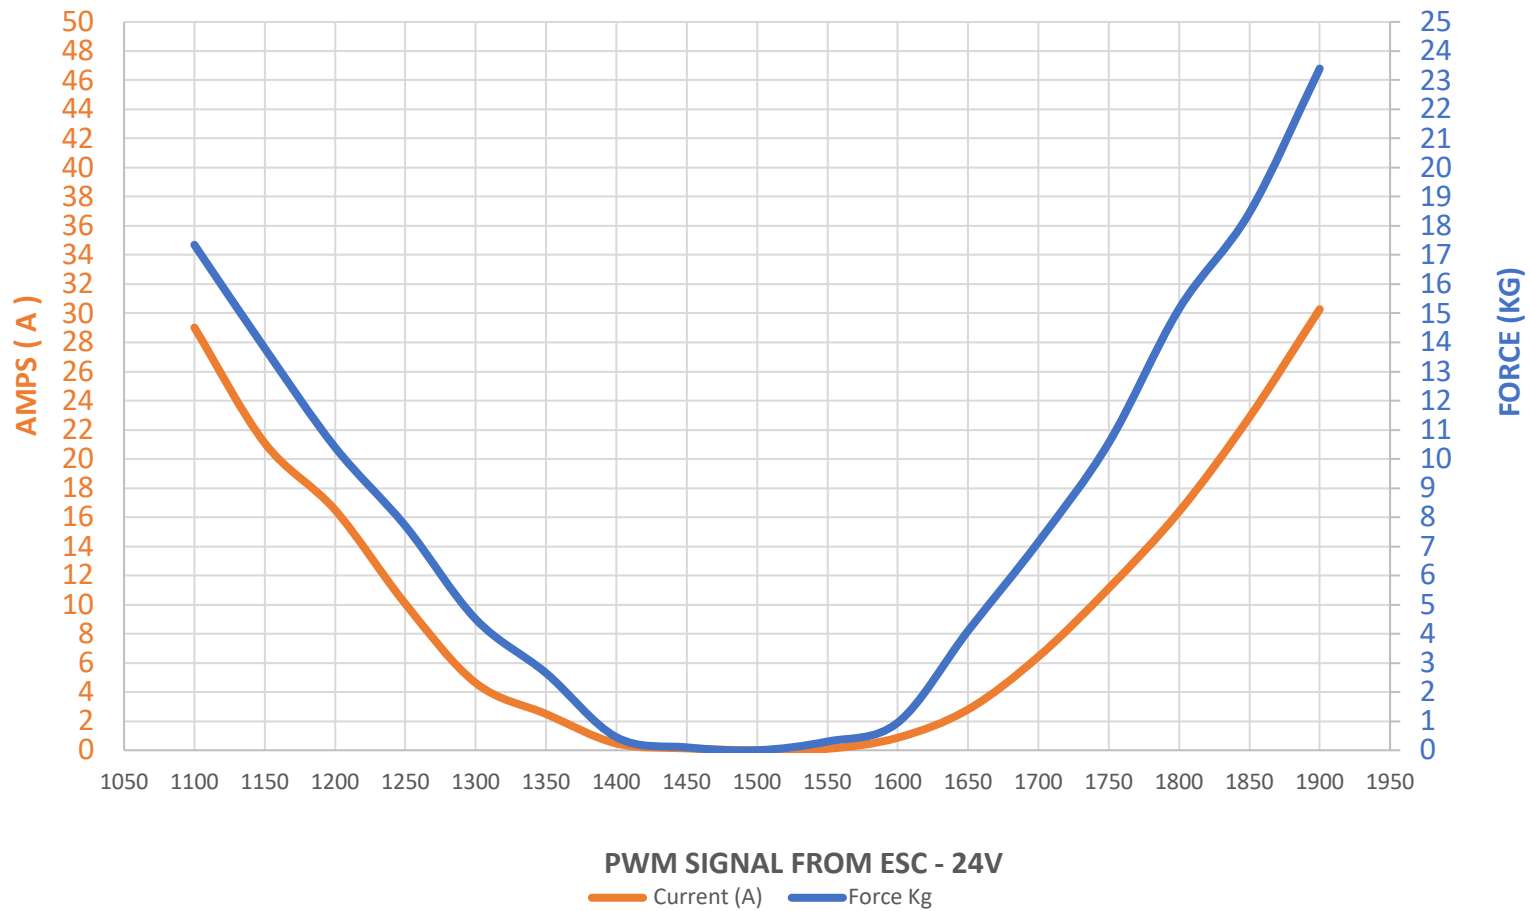


PWM (μs)	Force Kg	Current (A)	Voltage (V)	Power (W)
1100	17,35	29,02	24	696,48
1150	13,8	21,09	24	506,16
1200	10,4	16,5	24	396
1250	7,7	10,05	24	241,2
1300	4,5	4,62	24	110,88
1350	2,65	2,49	24	59,76
1400	0,45	0,47	24	11,28
1450	0,1	0,13	24	3,12
1500	0	0	24	0
1550	0,3	0,1	24	2,4
1600	0,95	0,86	24	20,64
1650	4,1	2,8	24	67,2
1700	7,15	6,43	24	154,32
1750	10,55	11,12	24	266,88
1800	15,15	16,38	24	393,12
1850	18,45	22,86	24	548,64
1900	23,4	30,28	24	726,72

A80 - CURRENT AND FORCE BY PWM

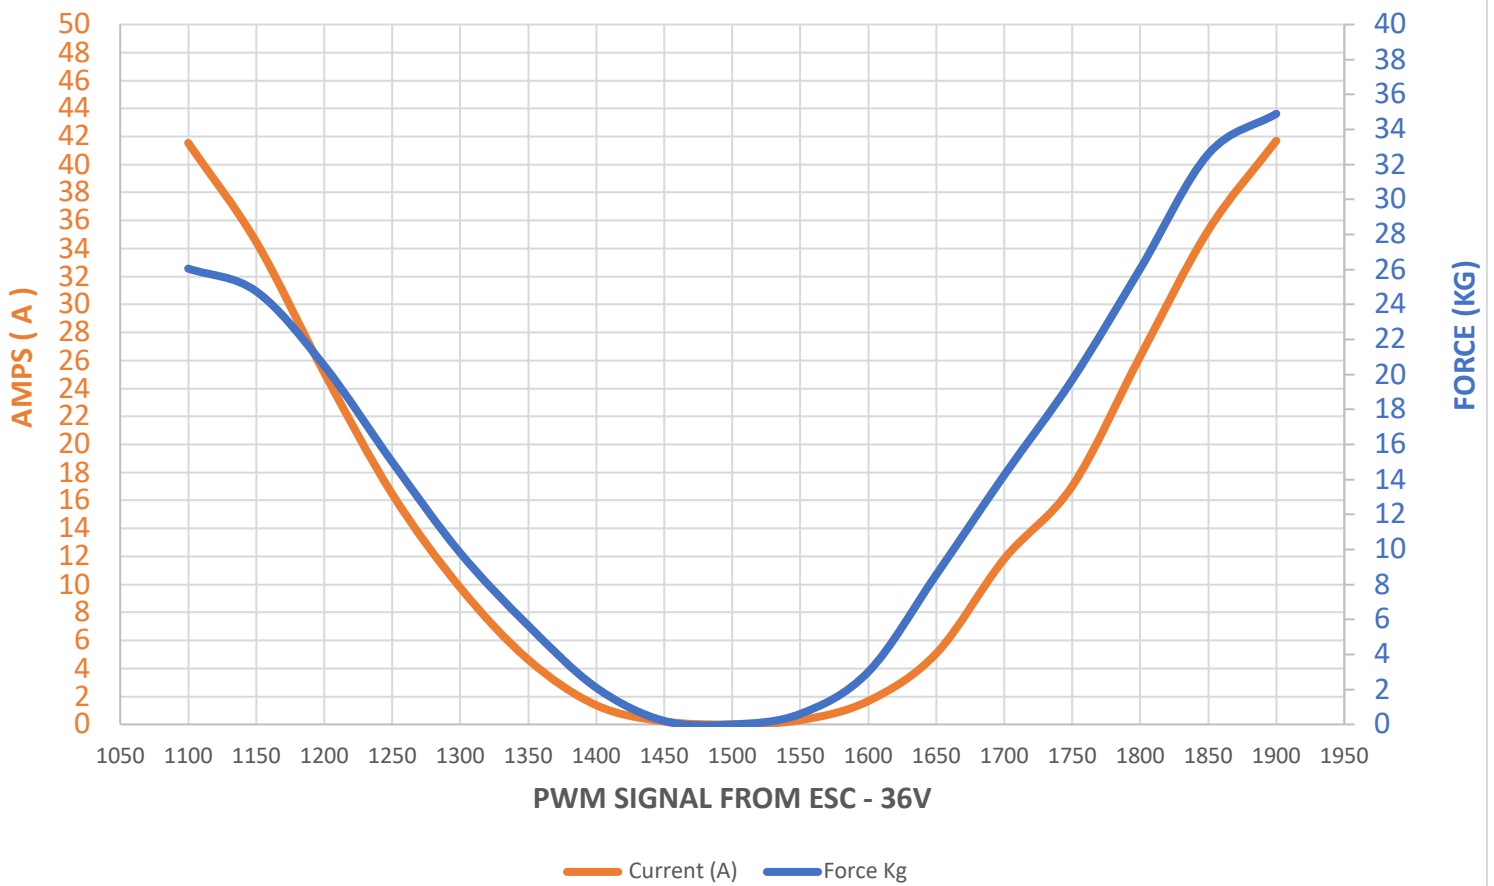

PWM (μs)	Force Kg	Current (A)	Voltage (V)	Power (W)
1100	26,05	41,54	36	1495,44
1150	24,75	34,47	36	1240,92
1200	20,5	25,12	36	904,32
1250	15	16,46	36	592,56
1300	9,8	9,77	36	351,72
1350	5,65	4,63	36	166,68
1400	2,1	1,37	36	49,32
1450	0,2	0,21	36	7,56
1500	0	0	36	0
1550	0,6	0,3	36	10,8
1600	3	1,67	36	60,12
1650	8,56	5,07	36	182,52
1700	14,25	11,83	36	425,88
1750	19,7	17,03	36	613,08
1800	26,05	26,3	36	946,8
1850	32,6	35,3	36	1270,8
1900	34,9	41,7	36	1501,2

A80 - CURRENT AND FORCE BY PWM

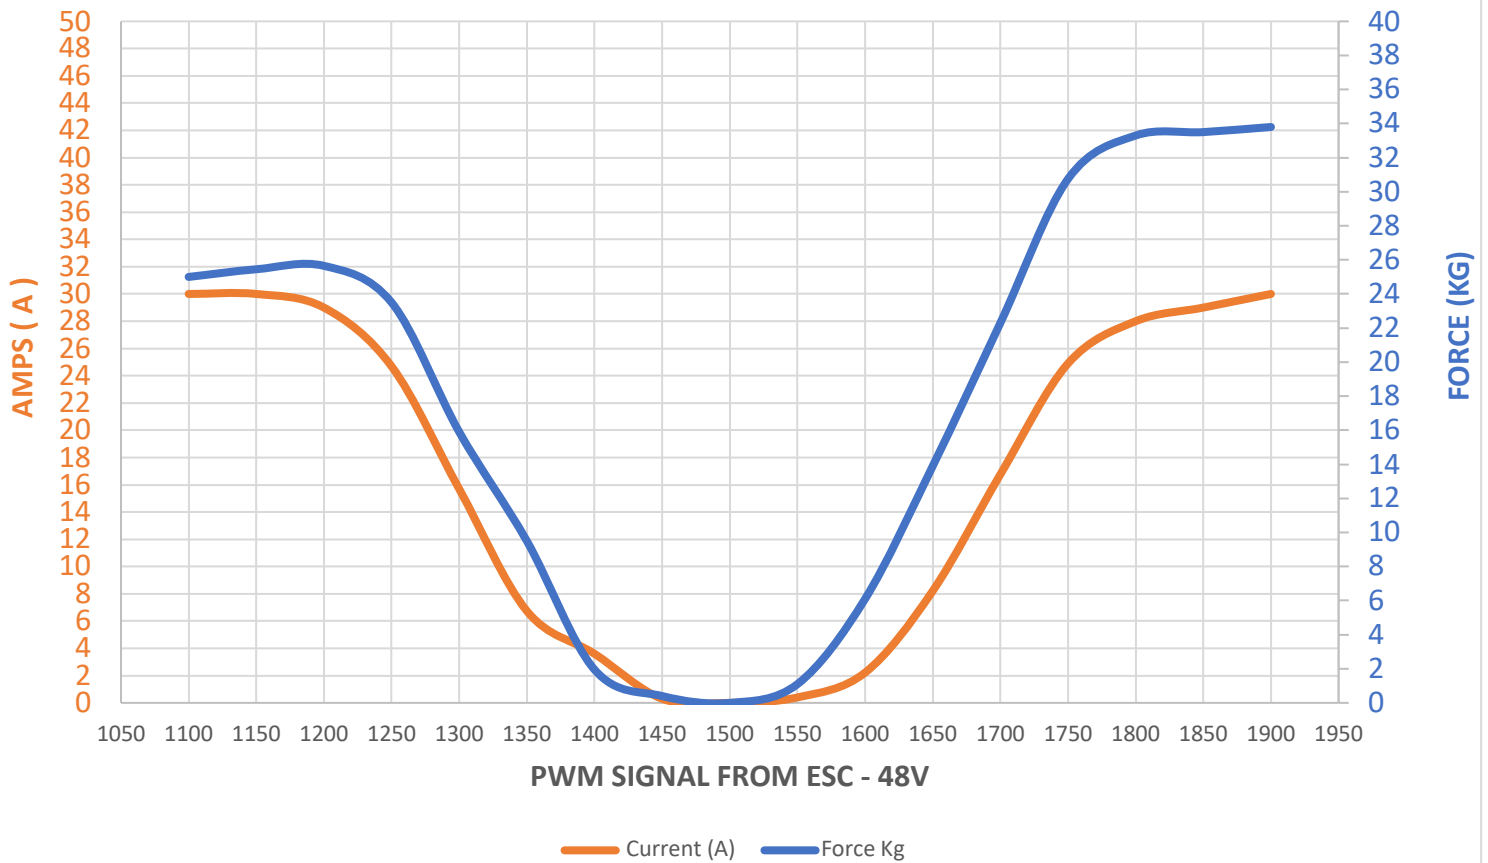

PWM (μs)	Force Kg	Current (A)	Voltage (V)	Power (W)
1100	25	30	48	1440
1150	25,45	30	48	1440
1200	25,65	29	48	1392
1250	23,5	24,69	48	1185,12
1300	15,9	15,69	48	753,12
1350	9,5	6,74	48	323,52
1400	1,95	3,6	48	172,8
1450	0,4	0,3	48	14,4
1500	0	0	48	0
1550	1,1	0,4	48	19,2
1600	6,1	2,22	48	106,56
1650	13,9	8,21	48	394,08
1700	22,3	16,76	48	804,48
1750	30,75	24,9	48	1195,2
1800	33,3	28	48	1344
1850	33,5	29	48	1392
1900	33,8	30	48	1440